

Work Order ID 77472

December-08-11 8:01:36 AM

77472

Page 1

Item ID: D2221 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: 350 Basket Base
 Start Date: 08/12/2011 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 20/12/2011 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: M.L.J Date: 11/12/08 Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D2221	Rev H								

100 0.00

100

Large Fab

Large Fab

Large Fab

Memo

0.00

1- assemble all ribs and both D2581 in DT9444 jig, weld as per dwg D2221
 2- remove basket from jig and weld D3442-1 shims and D2232-3 hinges as per dwg D2221
 3- tack weld mesh on basket as per dwg D2221
 A/R ER316 S.S. Rod Batch: 1415778

PLEASE NOTE

IF MAKING -041A OR -043A :
 DRILL HOLES FOR GAS SPRING
 IN D3825-041 AS PER
 DSI 9473

110

QC9- Inspect visual per QSI004- Fusion Welds 0.00

110

QC

Quality Control

Memo

0.00

11/12/14 (12)

11.12.14

1x

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

December-08-11 8:01:36 AM

Page 2

Hand Finishing

$\sum_{n=0}^{\infty} n! z^{1/n}$

140m 11/12/16

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 77472

December-08-11 8:01:36 AM

77472

Page 3

Item ID: D2221 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: 350 Basket Base
 Start Date: 08/12/2011 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 20/12/2011 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130	White Gloss(Ref:4.3.5.2) per QSI005 4.3-Steel	0.00							
-----	---	------	--	--	--	--	--	--	--

130

Powdercoat

Powder Coating

Memo

1- Plug holes prior to

1ST COAT:

START TIME: 9:15

OVEN TEMPERATURE: 400°F

FINISH TIME: 9:45

***** 2nd coat if necessary *****

2ND COAT:

START TIME: _____

OVEN TEMPERATURE: _____

FINISH TIME: _____

Handwritten: 1X M-11/12/16

140	QC3- Inspect Part Finish	0.00							
-----	--------------------------	------	--	--	--	--	--	--	--

140

QC

Quality Control

Memo

0.00

Handwritten: 1 DE 11-12-16

Handwritten: M119480

Handwritten: 9:15 400°F 9:45

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 77472

December-08-11 8:01:36 AM

77472

Page 4

Item ID: D2221

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: 350 Basket Base

Stop ***NS2***

Start Date: 08/12/2011 Start Qty: 1.00

1

Cust Item ID:

Required Date: 20/12/2011 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

150

Identify as per dwg & Stock Location: **G.A**

0.00

150

Packaging

Memo

0.00

Packaging

w/o
77466**11/12/19** @

160

QC21- Final Inspection - Work Order Release

0.00

160

QC

Memo

0.00

Quality Control

11/12/2019
PIF 12-20
@

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

December-08-11 8:01:40 AM

Page 1

Work Order ID: 77472

77472

Parent Item: D2221

D2221

Parent Item Name: 350 Basket Base

Start Date: 08/12/2011

Required Date: 20/12/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:J 05.09.02 Added D3442-1 KJ/JLM
 IPP Rev:K 08-08-29 revG as per dwg DD verified by:EC
 IPP Rev:L 08-09-24 plug holes prior to powder coat DD verified by:EC
 IPP Rev:M 08-12-02 revH as per dwg DD verified by:EC IPP Rev:N
 10.06.29 added pressure wash DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
✓ D2221-1 *D2221-1* Rib		Manufactured	No			100	Each	16.0000	1	1	**	11/12/14	
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				WA006		16							
				71372		4							
				72297		12							
✓ D2221-5 *D2221-5* Rib		Manufactured	No			100	Each	12.0000	2	2	**	11/12/14	
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				WA006		12							
				67117		2							
				71218		10							
✓ D2221-7 *D2221-7* Rib		Manufactured	No			100	Each	8.0000	1	1	**	11/12/14	
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				WA006		8							
				71219		1							
				72731		3							
				73203		4							

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

December-08-11 8:01:40 AM

Page 2

Work Order ID: 77472

77472

Parent Item: D2221

D2221

Parent Item Name: 350 Basket Base

Start Date: 08/12/2011

Required Date: 20/12/2011

Start Qty: 1.00

Required Qty: 1.00

D2232-3 Manufactured No

100 Each 16.0000 2

D2232-3

Basket Hinge

**

Handwritten: 11/12/14

Location

Loc Qty

Loc Code

WA005

16

75581

16

D2235-1 Manufactured No

100 Each 13.0000 2

D2235-1

Basket Rib

**

Handwritten: 11/12/14

Location

Loc Qty

Loc Code

WA005

13

66895

4

73200

9

D2581 Manufactured No

100 Each 32.0000 2

D2581

Mounting Bracket

**

Handwritten: 11/12/14

Location

Loc Qty

Loc Code

WA005

32

69739

2

70766

2

73762

3

75280

25

D3442-1 Manufactured No

100 Each 19.0000 2

D3442-1

Shim

**

Handwritten: 11/12/14

Location

Loc Qty

Loc Code

WA005

19

71224

4

71783

15

Handwritten: 11/12/14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

December-08-11 8:01:40 AM

Page 3

Work Order ID: 77472

77472

Parent Item: D2221

D2221

Parent Item Name: 350 Basket Base

Start Date: 08/12/2011

Required Date: 20/12/2011

Start Qty: 1.00

Required Qty: 1.00

✓ D3825-041 Manufactured No 100 Each 6.0000 2 2
D3825-041
 Rib Assembly (Basket End) ** *11/12/14*

Location	Loc Qty	Loc Code
WA006	6	
72727	6	

✓ D3826-041 Manufactured No 100 Each 6.0000 2 2
D3826-041
 Rib / Gusset Assembly ** *11/12/14*

Location	Loc Qty	Loc Code
WA	4	
72728	4	
WA006	2	
73749	2	

/ D3827-041 Manufactured No 100 Each 9.0000 1 1
D3827-041
 Rib Assembly (Inboard) ** *11/12/14*

Location	Loc Qty	Loc Code
WA006	9	
72083	3	
72729	6	

✓ D3832-1 Manufactured No 100 Each 2.0000 1 1
D3832-1
 Mesh (Base) ** *11/12/14*

Location	Loc Qty	Loc Code
WA006	2	
72702	2	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

December-08-11 8:01:40 AM

Page 4

Work Order ID: 77472

77472

Parent Item: D2221

D2221

Parent Item Name: 350 Basket Base

Start Date: 08/12/2011

Required Date: 20/12/2011

Start Qty: 1.00

Required Qty: 1.00

D3833-1

Manufactured No

100

Each

8.0000

2

2

✓ *D3833-1*
Mesh (Base End Face)

**

SL 11/12/14

Location

Loc Qty

Loc Code

WA

8

70470

6

71834

1

72866

1

2x


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

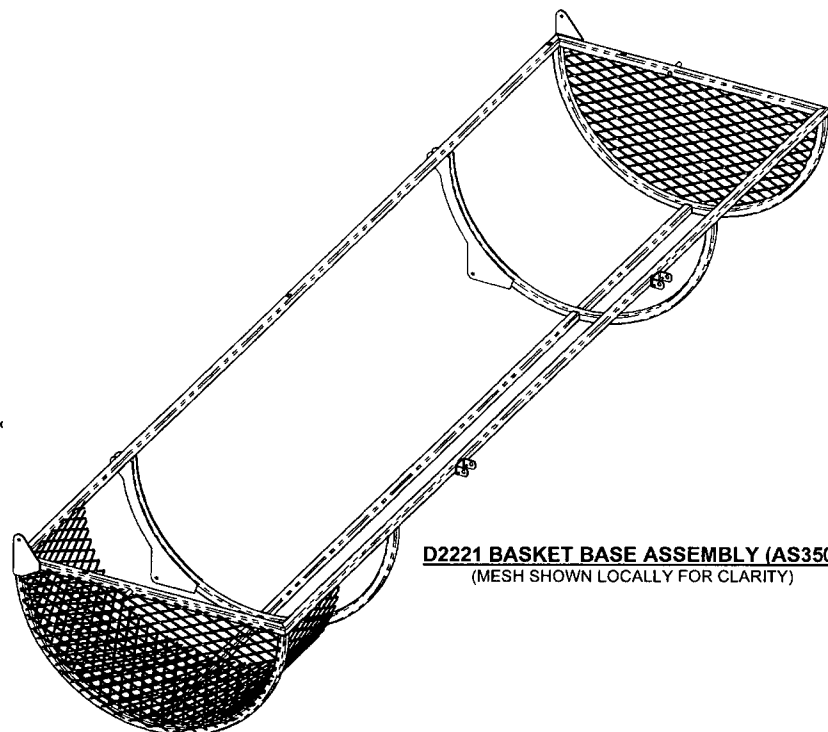

D2221 BASKET BASE ASSEMBLY (AS350)
(MESH SHOWN LOCALLY FOR CLARITY)

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED
SUBJECT TO APPROVAL
WITHOUT NOTICE
WORK ORDER
NO. 77472 M.L.S.

11/12/08

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: POWDER COAT GLOSS WHITE (4.3.5.2) PER DART QSI 005 4.3
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: N/A
- 7) WEIGHT: 42.00 lbs APPROX
- 8) MASK ALL HOLES PRIOR TO POWDER COATING

ITEM	QTY	P/N	DESCRIPTION
1	X	D2221	BASKET BASE ASSEMBLY (AS350)
2	1	D2221-1	RIB
3	2	D2221-5	RIB
4	1	D2221-7	RIB
5	2	D2232-3	BASKET HINGE
6	2	D2235-1	RIB
7	2	D2581	MOUNTING BRACKET
8	2	D3442-1	SHIM
9	2	D3825-041	RIB ASSY (BASKET END)
10	2	D3826-041	RIB/GUSSET ASSY
11	1	D3827-041	RIB ASSY (INBOARD)
12	2	D3833-1	MESH, BASE END FACE
13	1	D3832-1	MESH (BASE)

H	REVISED PARTS LIST AND ADDED "ITEM" COLUMN TO PARTS LIST (ZN D3-1); REVISED SECTIONS A-A, B-B AND C-C (ZN C6-3, C2-3 AND A6-3); REVISED DETAIL D (ZN B7-4); ADDED DETAIL E (ZN A6-4); ADDED SECTION F-F (ZN B2-4); ADDED DWG DETAILS FOR D2221-1/5/7 (SHEET 5); TOL REVISED TO 2 DEC PLACES (ZN D8-3 AND ZN B4-3); D3825-041 REPLACES D2221-3/D2327-3; D3826-041 REPLACES D2235-1/D2325; D3827-041 REPLACES D2221-1 ON INBOARD SIDE; ADDED D3832-1 AND D3833-1. REASON: SATISFY "LEAN MANUFACTURING" PROGRAM.	MB	08.09.18
G	MATERIAL FOR -1, -3, -5 & -7 WAS 0.060 WALL. TOLERANCE FOR 96.00 DIM WAS +/-0.01 AND 56.00 DIM WAS REF (ZN B5-2); 19.62 DIM WAS "HARD" DIMENSION IS NOW "REF" (ZN B4-2); NOTE 5 TRANSFERRED FROM SHT 1 TO SHT 2; SHT 2 MESH MATERIAL UPDATED; DRAWING TRANSFERRED TO "B" FORMAT	AJS	08.06.16
F	ADD SHIM UNDER HINGE; ADD HOLES FOR SPLIT LID BASKET	PH	05.06.07
E	CHANGE HINGE	CP	01.04.19
D	CHANGE LATCH	BW	95.06.21
C	SEPARATE BASKET AND LID	KH	95.11.21
REV.	DESCRIPTION	BY	DATE
DESIGN	BW	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	JS		
CHECKED	JS	DRAWING NO.	REV. H
MFG. APPR.	JS	D2221	SHEET 1 OF 5
APPROVED	JS	TITLE	SCALE
DE APPR.	JS	BASKET BASE ASSEMBLY (350)	NTS
DATE	08.09.18	<small>COPYRIGHT © 1984 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector



Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

77472

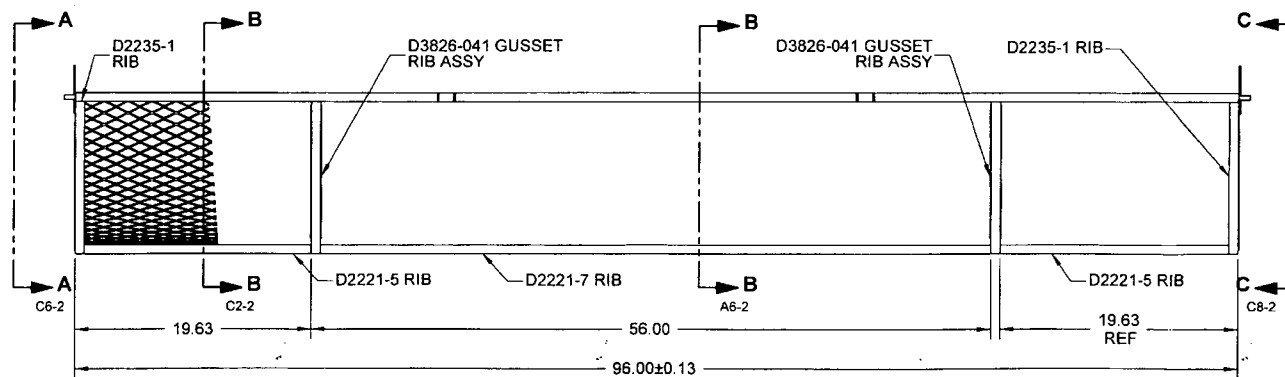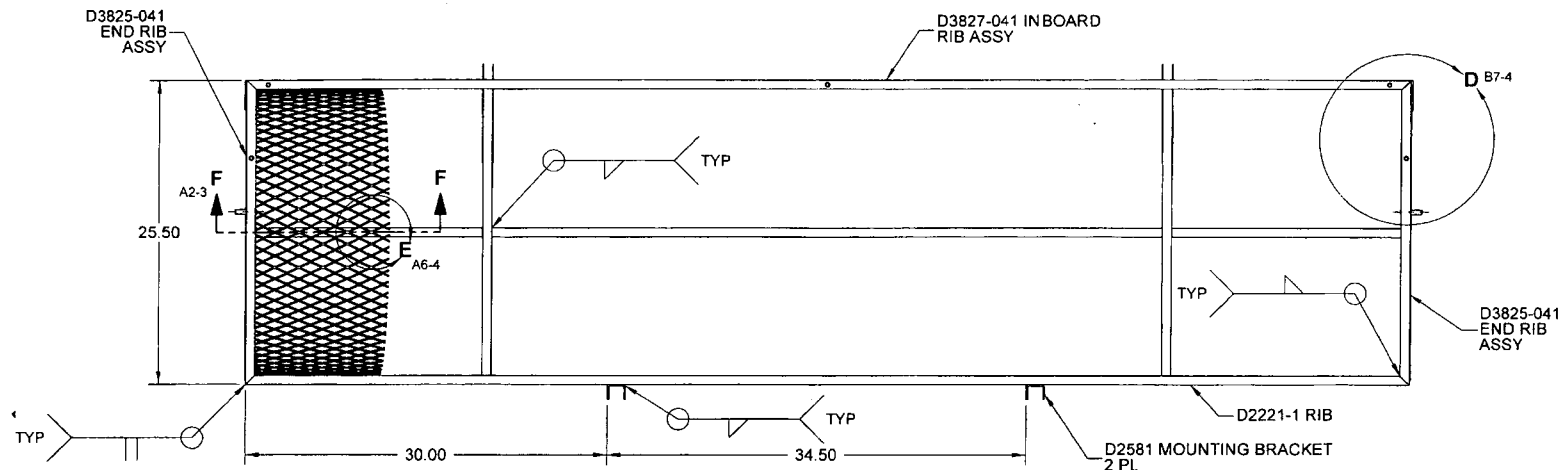

D2221 BASKET BASE ASSEMBLY (350)
(MESH SHOWN LOCALLY FOR CLARITY)

RELEASED
06/11/18 NED

DESIGN	BW	DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D2221	SHEET 2 OF 5
APPROVED		TITLE	SCALE
DE APPR.		BASKET BASE ASSEMBLY (350) NTS	
DATE	08.09.18	COPYRIGHT © 1994 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD			

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

77472

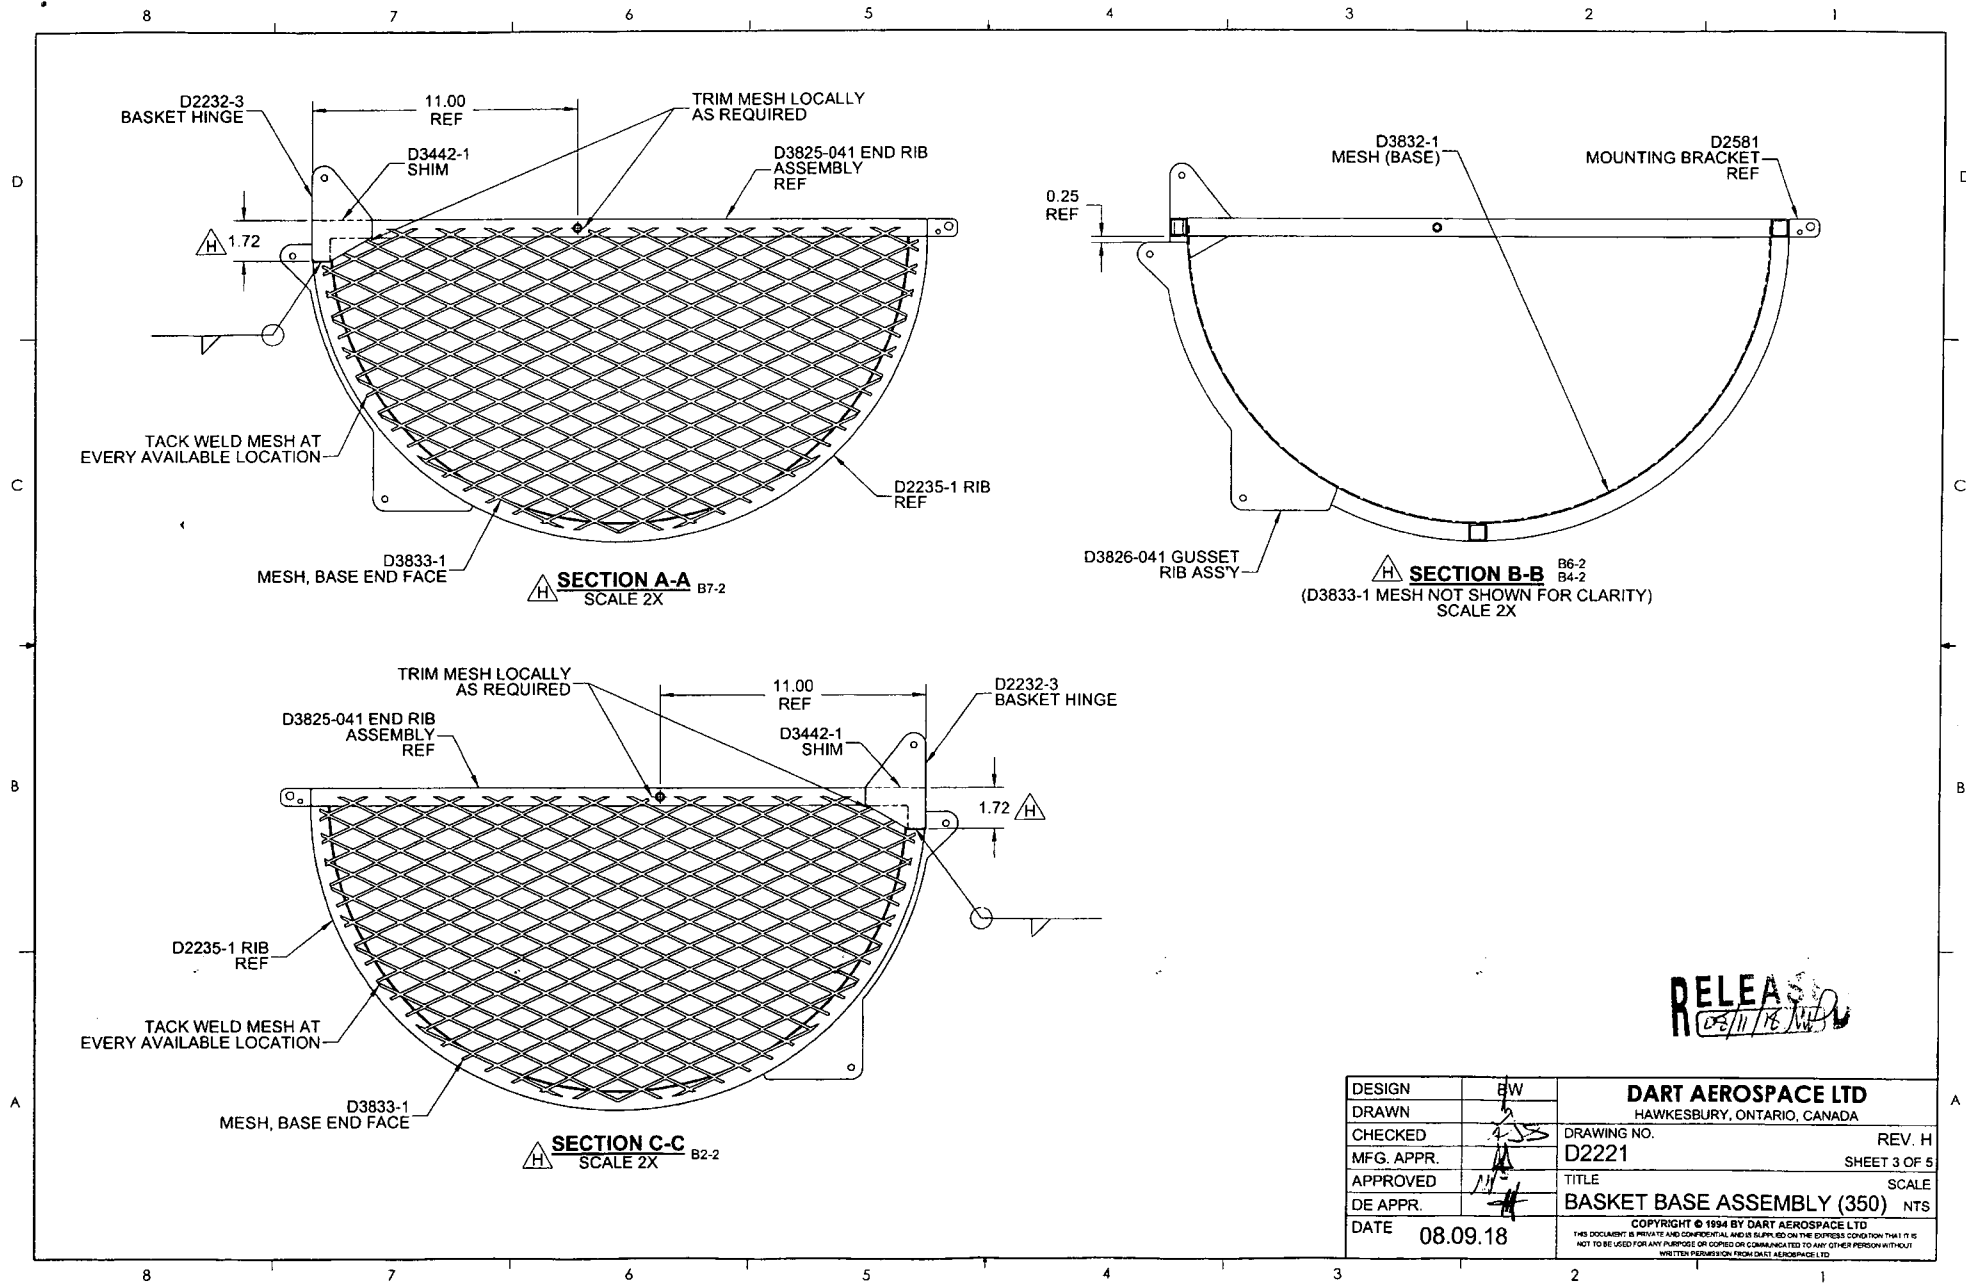

RELEASE
03/11/16

DESIGN	BW	DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED	435	DRAWING NO.	REV. H
MFG. APPR.		D2221	SHEET 3 OF 5
APPROVED	11	TITLE	SCALE
DE APPR.		BASKET BASE ASSEMBLY (350)	NTS
DATE	08.09.18	<small>COPYRIGHT © 1994 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

77472

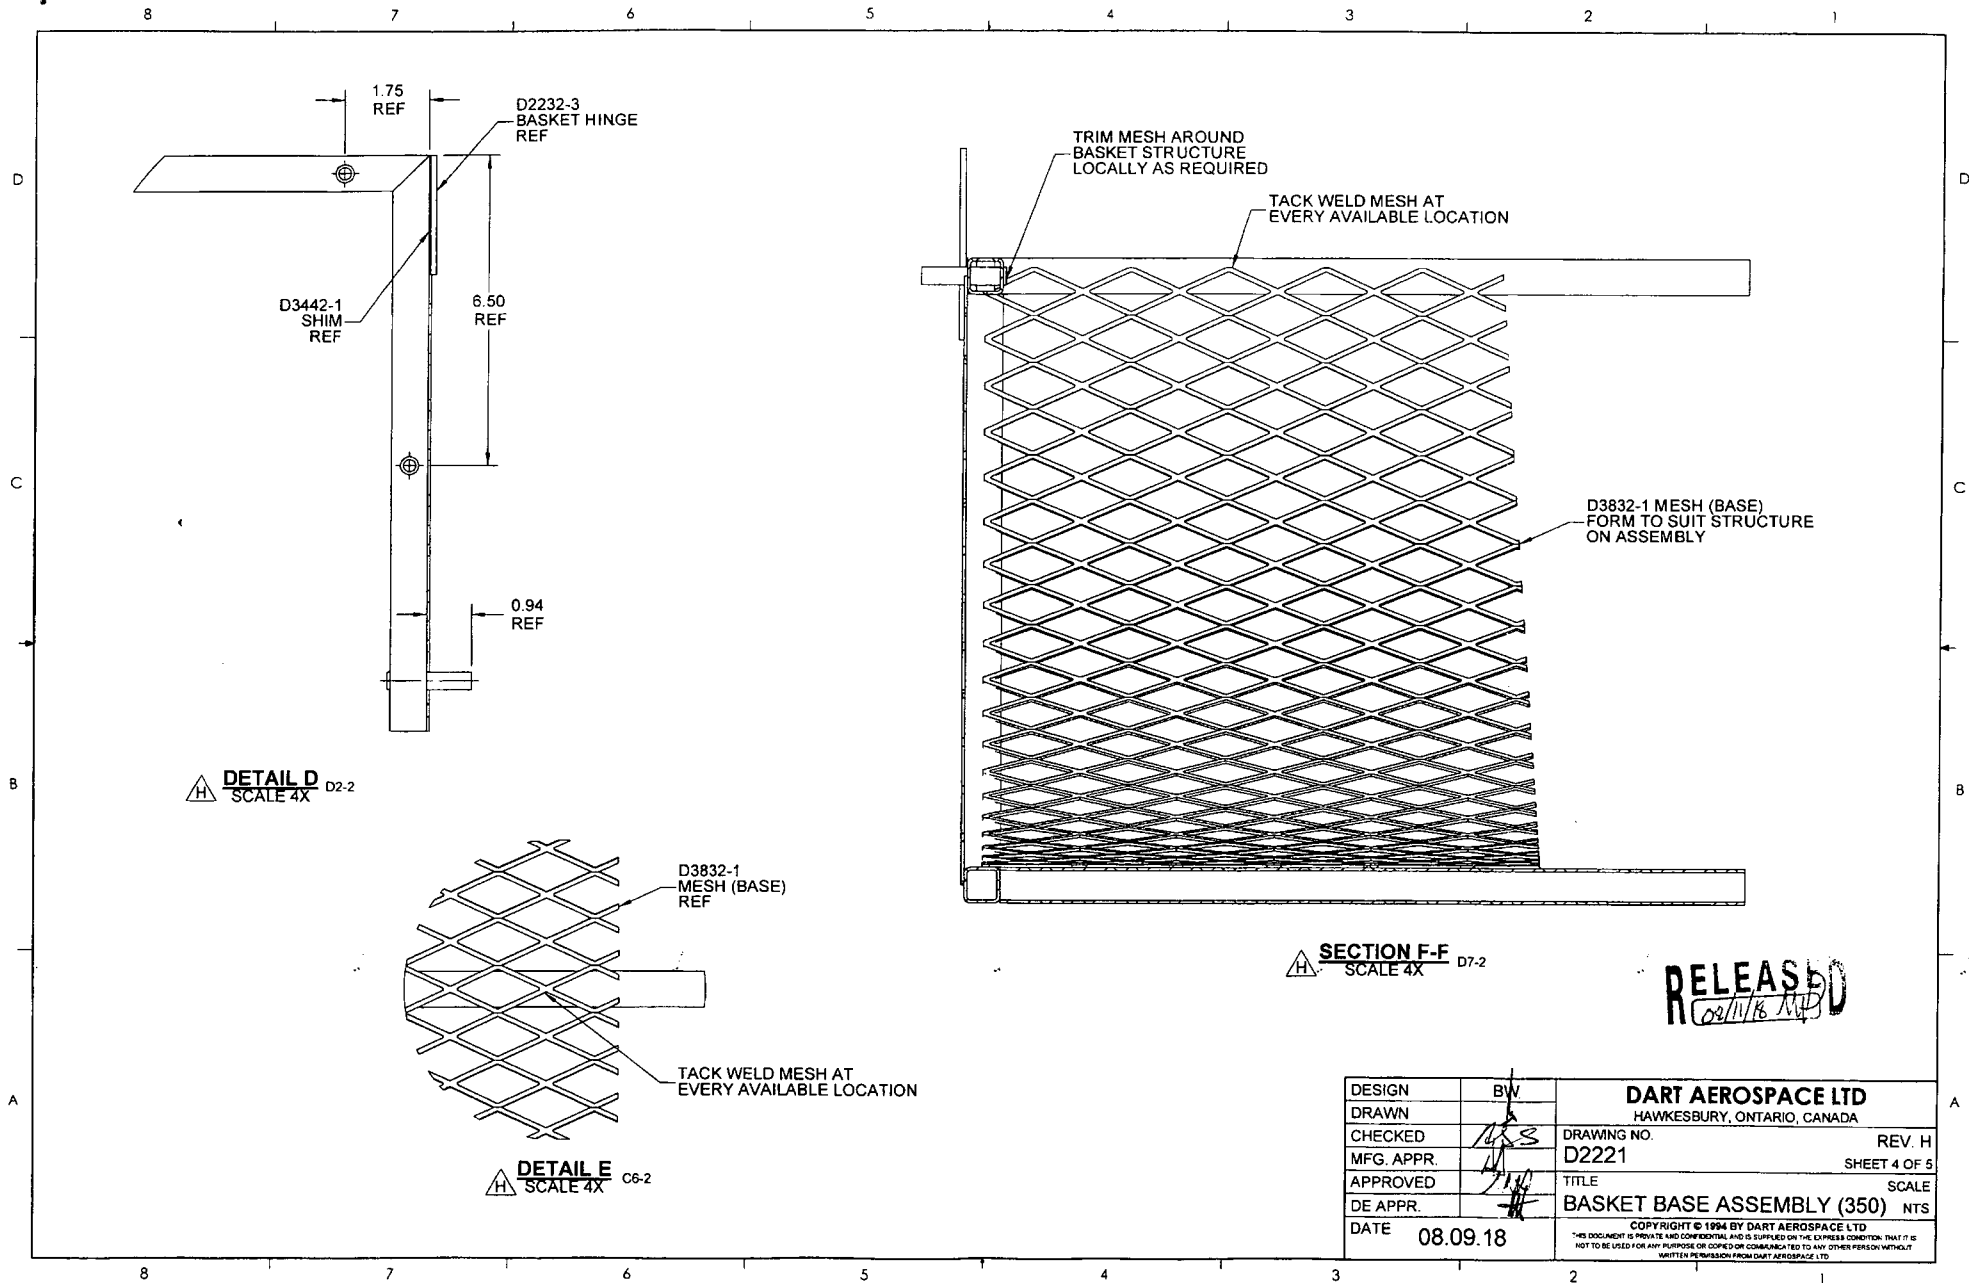

RELEASED
02/11/8

DESIGN	BW	DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED	14.8	DRAWING NO.	REV. H
MFG. APPR.		D2221	SHEET 4 OF 5
APPROVED	14.8	TITLE	SCALE
DE APPR.		BASKET BASE ASSEMBLY (350) NTS	
DATE	08.09.18	COPYRIGHT © 1994 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD			

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector



Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			



NOTE: Date & initial all entries

77472

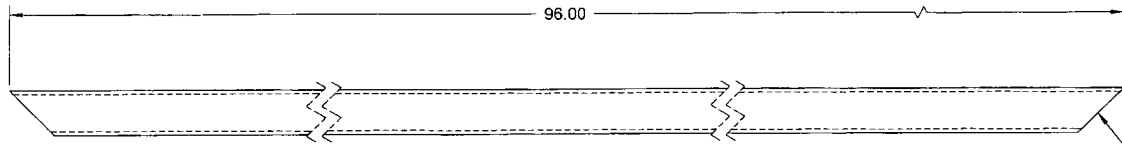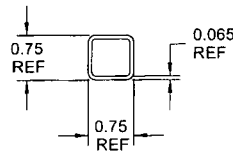

D2221-1 RIB

0.75 X 45° CHAMFER
2 PL

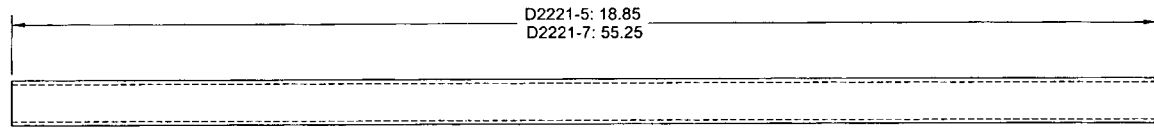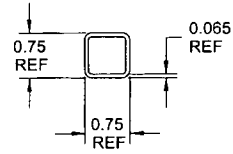

D2221-5/-7 RIB

RELEASED
06/11/18

- NOTES:**
- 1) MATERIAL: AISI 304/316 STAINLESS STEEL SQUARE TUBE, 0.75 X 0.75 X 0.065 WALL
REF. DART SPEC. M304TS0.750W0.065
 - 2) FINISH: NONE
 - 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
 - 4) UNITS: INCHES UNLESS OTHERWISE NOTED
 - 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
 - 6) IDENTIFICATION: N/A
 - 8) WEIGHT: D2221 -1 = 4.57 lbs; D2221-5 = 0.90 lbs; D2221-7 2.65 = lbs

DESIGN	BW	DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED	AS	DRAWING NO.	REV. H
MFG. APPR.	MD	D2221	SHEET 5 OF 5
APPROVED	W	TITLE	SCALE
DE APPR.	CH	BASKET BASE ASSEMBLY (350)	NTS
DATE	08.09.18	<small>COPYRIGHT © 1994 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART SERVICE INSTRUCTION

TO AMEND DRAWING D350-607 REV. F OR SUBSEQUENT APPROVED REVISION

REF CANADIAN STC: SH94-14

FAA STC: SR00213NY

EASA STC: EASA.IM.R.S.01405

THE PURPOSE OF THIS DART SERVICE INSTRUCTION (DSI), IS TO PROVIDE OPERATORS OF AS350 / 355 ROTORCRAFT EQUIPPED WITH DART D350-607-041 HELI UTILITY BASKETS WITH AN UPGRADE KIT TO REPLACE THE EXISTING LID PROP ARM WITH 2 GAS SPRINGS.

FOR OPERATORS EQUIPPED WITH D350-607-043/-045/-047 HELI UTILITY BASKETS THIS DSI WILL PROVIDE AN UPGRADE KIT TO REPLACE THE EXISTING LID PROP ARM WITH 1 GAS SPRING.

ITEM No.	QTY -141	QTY -143	QTY -145	PART NUMBER	DESCRIPTION
1	X			D350-607-141	AUTOMATIC LID OPENER INSTL (FOR USE ON -041 BASKET*)
2		X		D350-607-143	AUTOMATIC LID OPENER INSTL (FOR USE ON -043/-047 BASKET*)
3			X	D350-607-145	AUTOMATIC LID OPENER INSTL (FOR USE ON -045 BASKET*)
4	2		1	D3953-1	GAS SPRING BRACKET
5	2	1	1	D3953-3	GAS SPRING STUD (LID)
6	2	1	1	D3953-5	GAS SPRING STUD (BASE)
7	2	1	1	D3953-7	GAS SPRING SPACER
8	4	2	2	D3953-9	GAS SPRING WASHER
9	2	1	1	D3953-11	GAS SPRING SPACER
10	2		1	D3953-13	GAS SPRING SPACER
11		1		D3953-15	GAS SPRING BRACKET
12		1		D3953-17	GAS SPRING SPACER
13	2	1	1	D3969-1	GAS SPRING
14	4	2	2	AN3C11A	BOLT
15		2		AN3C15A	BOLT
18	4		2	AN3C16A	BOLT
19	4	2	2	AN310-4	CASTELLATED NUT
20	8	4	4	MS21043-3	NUT
21	4	2	2	MS24665-212	COTTER PIN
22	8	4	4	NAS1149C0332R	WASHER (OR AN960C10L)
23	4	2	2	NAS1149C0432R	WASHER (OR AN960C416L)

REFERENCE ONLY

REFERENCE ONLY

***NOTE:** FOR CUSTOMERS WISHING TO ORDER NEW BASKETS WITH THE LID OPENER PRE-INSTALLED USE THE FOLLOWING NUMBERS:



D350-607-041 BASKET WITH AUTOMATIC LID OPENER INSTALLED = D350-607-041A
D350-607-043 BASKET WITH AUTOMATIC LID OPENER INSTALLED= D350-607-043A
D350-607-045 BASKET WITH AUTOMATIC LID OPENER INSTALLED = D350-607-045A
D350-607-047 BASKET WITH AUTOMATIC LID OPENER INSTALLED = D350-607-047A

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: 
D. SHEPHERD (DE # 02)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

C	SHEET 1 PL, -143 INSTL, ITEM 6 QTY WAS 2, ITEM 7 WAS 0.	AJS	09.11.11
B	SHT 1 P/L ITEM 22 WAS NAS1149C0332 ITEM 23 WAS NAS1149C0432H. ALL OTHER SHEETS UPDATED ACCORDINGLY. (REASON: DRAFTING ERROR) INSTALLATIONS RENAMED.	AJS	09.11.06
A	NEW ISSUE	AJS	09.09.15
REV.	DESCRIPTION	BY	DATE
DESIGN	AJS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED		DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	<small>COPYRIGHT © 2009 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

FOR D350-607-041 BASKETS, REPLACE THE EXISTING D2332-041 PROP ARM ASSEMBLY AS FOLLOWS:

D350-607-141 AUTOMATIC LID OPENER INSTALLATION

NOTE: ONCE THIS MODIFICATION IS COMPLETE YOU WILL NOT BE ABLE TO RE-INSTALL THE D2332-041 PROP ARM.

- 1) REMOVE THE D2332-041 PROP ARM.
- 2) GRIND FLUSH THE D2327-3 SPACER BUSHING ON BOTH ENDS OF THE BASKET AS SHOWN IN FIGURE 1 (IT IS PERMISSIBLE TO GRIND ALL 4 SPACERS FLUSH). TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4.
- 3) LOCATE THE D3953-1 GAS SPRING BRACKET AS SHOWN IN FIGURE 1. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET LID SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL A. INSTALL THE D3953-1 GAS SPRING BRACKET & D3953-13 GAS SPRING SPACER USING 2X AN3C16A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT AS SHOWN IN VIEW E-E.
- 4) LOCATE THE D3953-5 GAS SPRING STUD AS SHOWN IN FIGURE 1. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET BASE SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL B. FASTEN D3953-5 IAW VIEW F-F USING 2X AN3C11A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT.
- 5) INSTALL 1X D3953-11 GAS SPRING SPACER ONTO THE D3953-5 STUD AS SHOWN IN VIEW F-F. INSTALL THE LARGE END OF THE D3969-1 GAS SPRING SPRING ONTO THE D3953-5 GAS SPRING STUD AND FASTEN IN PLACE USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW F-F. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.
- 6) INSERT THE D3953-3 GAS SPRING STUD INTO THE D3953-1 GAS SPRING BRACKET & INSERT THE D3953-7 GAS SPRING SPACER ONTO THE D3953-3 GAS SPRING AS SHOWN IN VIEW E-E. RAISE THE BASKET LID AND INSTALL THE ROD END OF THE D3969-1 GAS SPRING ONTO THE D3953-3 GAS SPRING STUD USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW E-E. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.

NOTE: THE D3953-3 GAS SPRING STUD CAN BE HELD IN PLACE WITH A $\frac{1}{16}$ OPEN END SPANNER / WRENCH.

NOTE: WITH THE LID IN THE CLOSED POSITION THE GAS SPRING SHOULD NOT BE FULLY COMPRESSED.




- 7) REPEAT STEPS 2 THROUGH 6 AT THE OTHER END OF THE BASKET.
- 8) TEST THE INSTALLATION. IF INSTALLED PROPERLY THE GAS SPRINGS SHOULD ASSIST THE BASKET USER IN BOTH OPENING AND CLOSING THE BASKET LID.

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: 
D. SHEPHERD (DE # 02)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

FOR D350-607-043/-047 BASKETS REPLACE THE EXISTING D2332-041 PROP ARM ASSEMBLY AS FOLLOWS:

D350-607-143 AUTOMATIC LID OPENER INSTALLATION

NOTE: THIS KIT MAY BE INSTALLED AT EITHER END OF THE BASKET. HOWEVER, THE PROP ARM MUST BE REMOVED IN EITHER CASE AS IT WILL INTERFERE WITH THE FUNCTION OF THE GAS SPRING.

- 1) REMOVE THE D2332-041 PROP ARM.
- 2) GRIND FLUSH THE D2327-3 SPACER BUSHING ON THE END OF THE BASKET WHERE THE LID OPENER IS BE INSTALLED AS SHOWN IN FIGURE 2 (IT IS PERMISSIBLE TO GRIND ALL 4 SPACERS FLUSH). TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4.
- 3) LOCATE THE D3953-15 GAS SPRING BRACKET AS SHOWN IN FIGURE 2. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET LID SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL C. INSTALL THE D3953-15 GAS SPRING BRACKET & D3953-17 GAS SPRING SPACER USING 2X AN3C15A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT AS SHOWN IN VIEW G-G.
- 4) LOCATE THE D3953-5 GAS SPRING STUD AS SHOWN IN FIGURE 2. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET BASE SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL D. INSTALL 2X AN3C11A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT AS SHOWN IN VIEW H-H. INSTALL THE ROD END OF THE D3969-1 GAS SPRING ONTO THE D3953-3 GAS SPRING STUD USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW H-H. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.
- 5) INSERT THE D3953-3 GAS SPRING STUD INTO THE D3953-15 GAS SPRING BRACKET & INSERT THE D3953-7 GAS SPRING SPACER ONTO THE D3953-3 GAS SPRING STUD AS SHOWN IN VIEW G-G. RAISE THE BASKET LID AND INSTALL THE D3969-1 GAS SPRING ONTO THE D3953-3 GAS SPRING STUD AND FASTEN IN PLACE USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW G-G. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.

NOTE: THE D3953-3 GAS SPRING STUD CAN BE HELD IN PLACE WITH A $\frac{9}{16}$ OPEN END SPANNER / WRENCH.

NOTE: WITH THE LID IN THE CLOSED POSITION THE GAS SPRING SHOULD NOT BE FULLY COMPRESSED.




- 6) TEST THE INSTALLATION. IF INSTALLED PROPERLY THE GAS SPRING SHOULD ASSIST THE BASKET USER IN BOTH OPENING AND CLOSING THE BASKET LID.

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: 
D. SHEPHERD (DE # 02)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

FOR D350-607-045 BASKETS REPLACE THE EXISTING D2332-041 PROP ARM ASSEMBLY AS FOLLOWS:

D350-607-145 AUTOMATIC LID OPENER INSTALLATION




NOTE: THIS KIT MAY BE INSTALLED AT EITHER END OF THE BASKET. HOWEVER, THE PROP ARM MUST BE REMOVED IN EITHER CASE AS IT WILL INTERFERE WITH THE FUNCTION OF THE GAS SPRING.


- 1) REMOVE THE D2332-041 PROP ARM.
 - 2) GRIND FLUSH THE D2327-3 SPACER BUSHING ON THE END OF THE BASKET WHERE THE LID OPENER IS BE INSTALLED AS SHOWN IN FIGURE 1 (IT IS PERMISSIBLE TO GRIND ALL 4 SPACERS FLUSH). TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4.
 - 3) LOCATE THE D3953-1 GAS SPRING BRACKET AS SHOWN IN FIGURE 1. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET LID SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL A. INSTALL THE D3953-1 GAS SPRING BRACKET & D3953-13 GAS SPRING SPACER USING 2X AN3C16A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT AS SHOWN IN VIEW E-E.
 - 4) LOCATE THE D3953-5 GAS SPRING STUD AS SHOWN IN FIGURE 1. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET BASE SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL B. FASTEN D3953-5 IAW VIEW F-F USING 2X AN3C11A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT.
 - 5) INSTALL 1X D3953-11 GAS SPRING SPACER ONTO THE D3953-5 STUD AS SHOWN IN VIEW F-F. INSTALL THE LARGE END OF THE D3969-1 GAS SPRING SPRING ONTO THE D3953-5 GAS SPRING STUD AND FASTEN IN PLACE USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW F-F. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.
 - 6) INSERT THE D3953-3 GAS SPRING STUD INTO THE D3953-1 GAS SPRING BRACKET & INSERT THE D3953-7 GAS SPRING SPACER ONTO THE D3953-3 GAS SPRING AS SHOWN IN VIEW E-E. RAISE THE BASKET LID AND INSTALL THE ROD END OF THE D3969-1 GAS SPRING ONTO THE D3953-3 GAS SPRING STUD USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW E-E. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.
- NOTE:** THE D3953-3 GAS SPRING STUD CAN BE HELD IN PLACE WITH A $\frac{9}{16}$ OPEN END SPANNER / WRENCH.

NOTE: WITH THE LID IN THE CLOSED POSITION THE GAS SPRING SHOULD NOT BE FULLY COMPRESSED.

- 7) TEST THE INSTALLATION. IF INSTALLED PROPERLY THE GAS SPRING SHOULD ASSIST THE BASKET USER IN BOTH OPENING AND CLOSING THE BASKET LID.

CANADA DEPARTMENT OF TRANSPORT AIRCRAFT CERTIFICATION BRANCH DAO # 01-O-01	
APPROVED	
BY:	
	D. SHEPHERD (DE # 02)
DATE:	09.11.11
CERT. NO.:	SH94-14
ISSUE NO.:	4

DESIGN	AJS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA
DRAWN	AJS	
CHECKED		DRAWING NO. REV. C
MFG. APPR.	N/A	DSI 9473 SHEET 4 OF 8
APPROVED		TITLE SCALE
DE APPR.		AUTOMATIC LID OPENER INSTL NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>

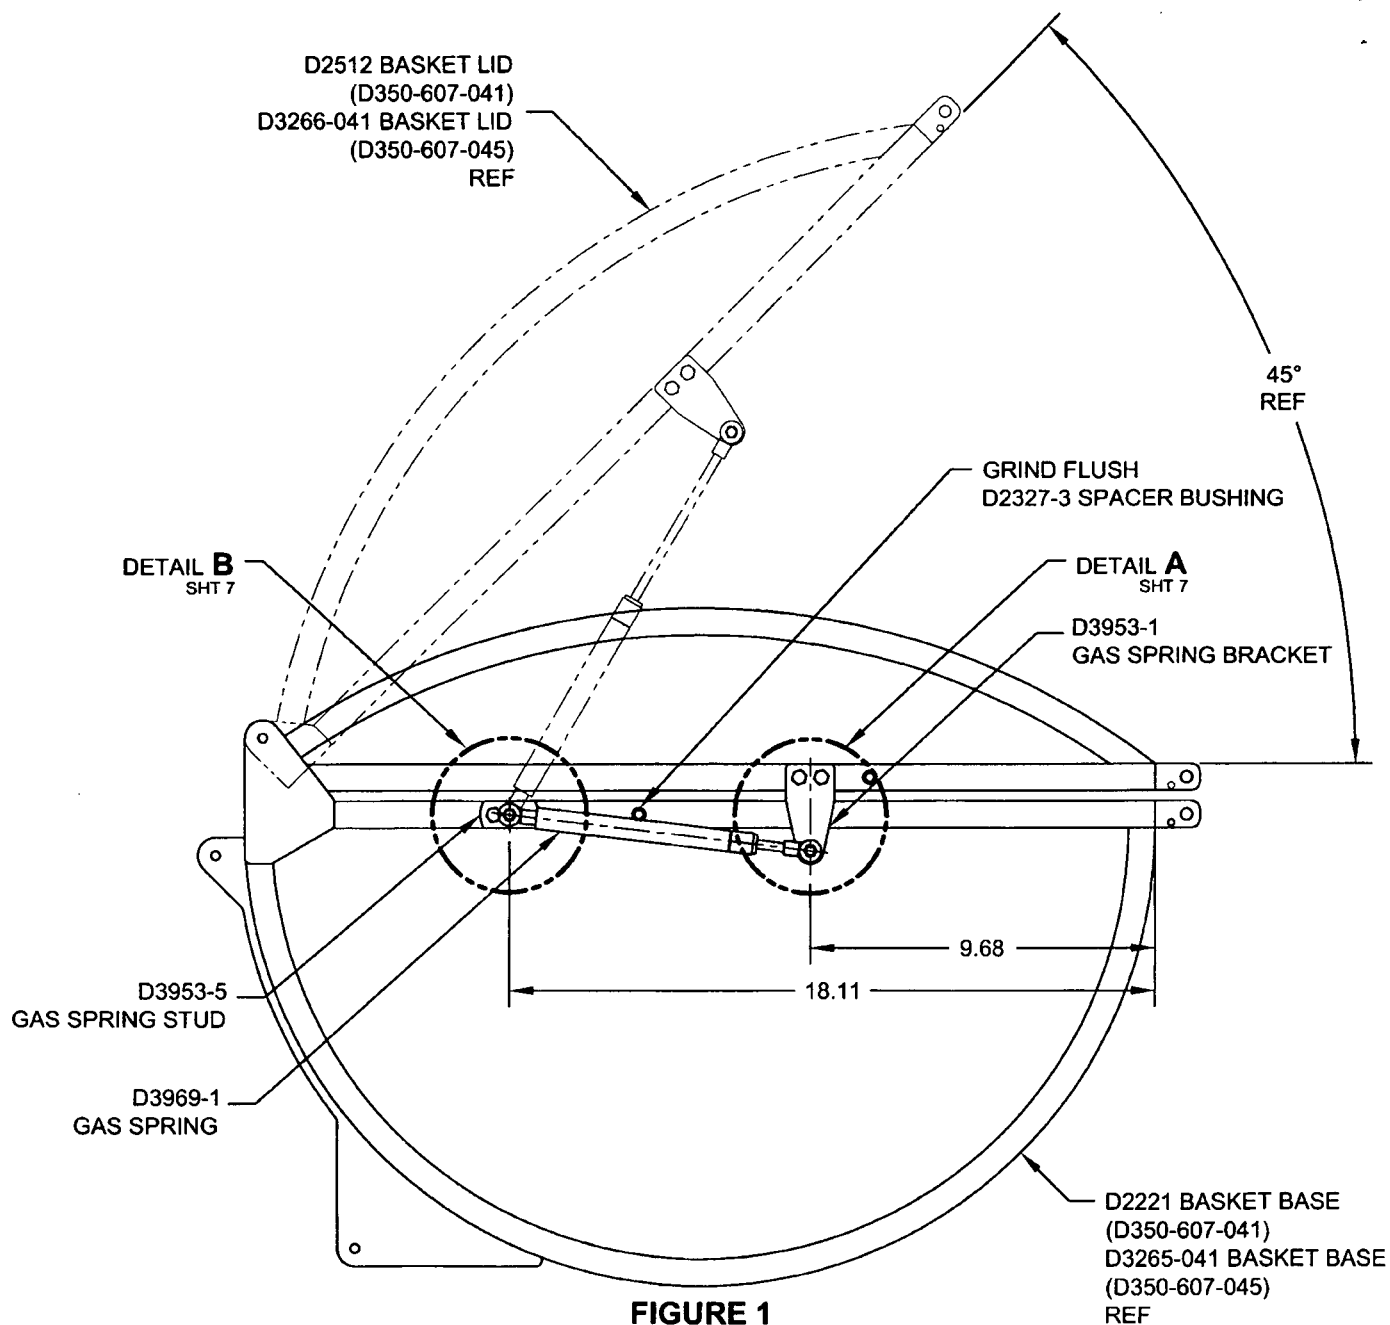

D350-607-141 AUTOMATIC LID OPENER INSTALLATION
(BOTH ENDS)




D350-607-145 AUTOMATIC LID OPENER INSTALLATION
(1 END ONLY)

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: *[Signature]*
D. SHEPHERD (DE # 82)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED		DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 5 OF 8
APPROVED		TITLE	SCALE
DE APPR.		AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

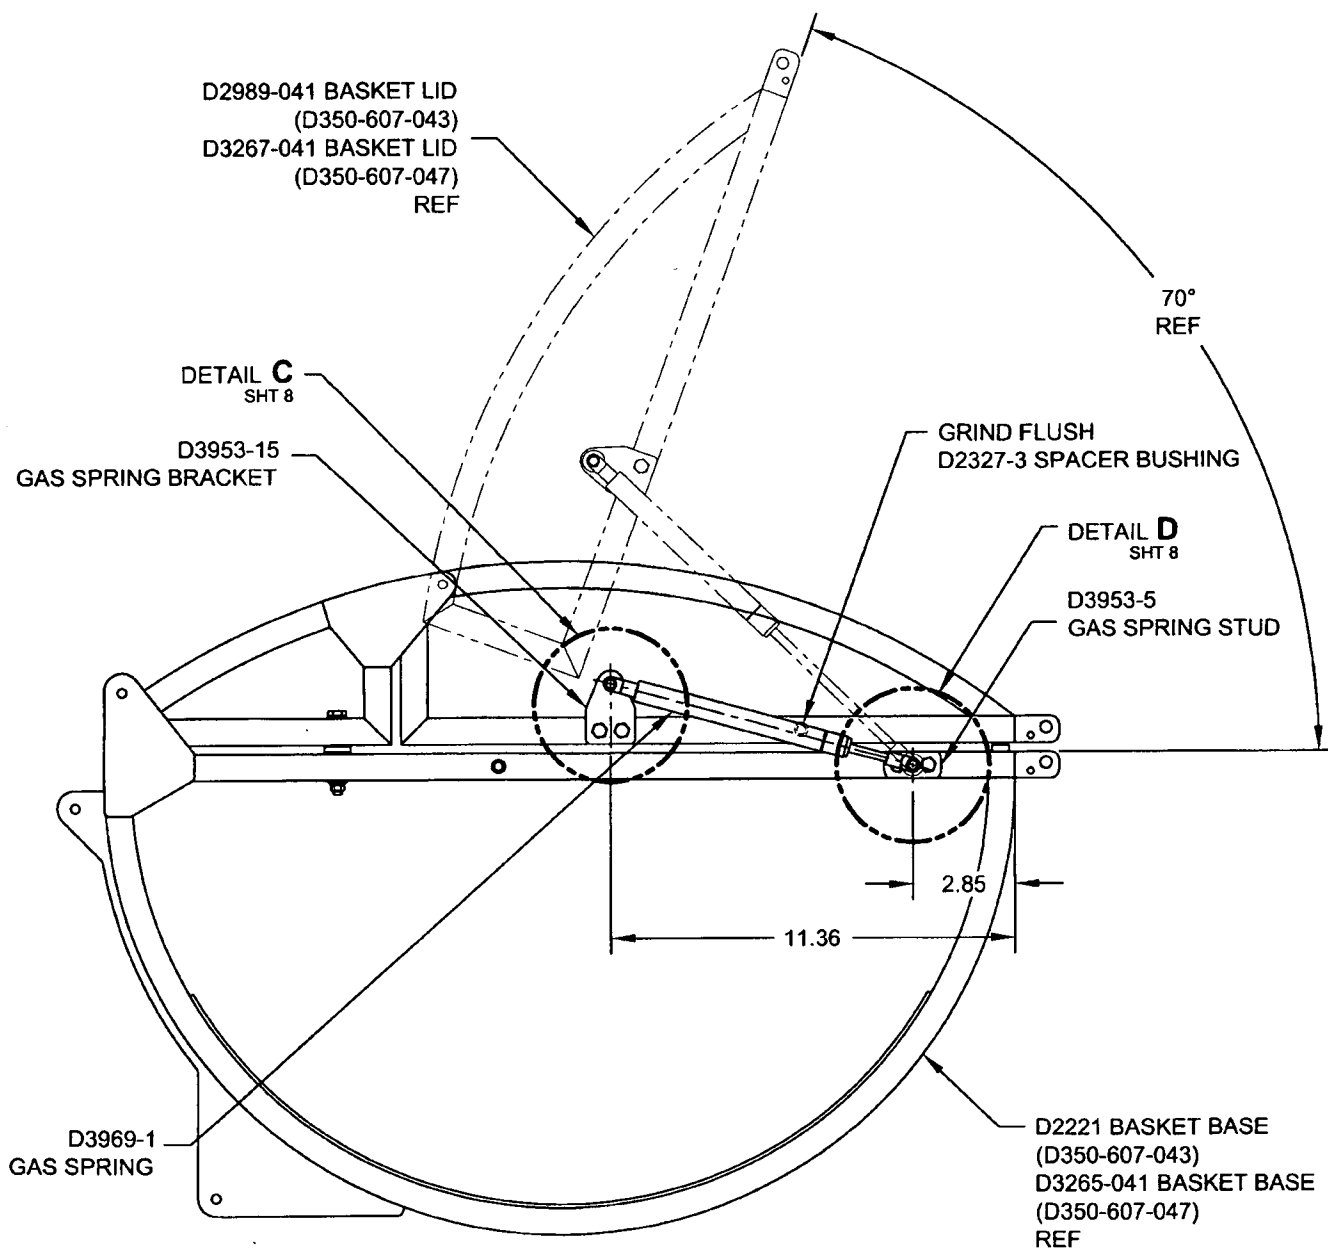


FIGURE 2
D350-607-143 AUTOMATIC LID OPENER INSTALLATION
 (1 END ONLY)

CANADA
 DEPARTMENT OF TRANSPORT
 AIRCRAFT CERTIFICATION
 BRANCH
 DAO # 01-O-01

APPROVED

BY: *[Signature]*
 D. SHEPHERD (DE # 02)

DATE: 09.11.11
 CERT. NO.: SH94-14
 ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 6 OF 8
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	


AN3C11A BOLT
NAS1149C0332R WASHER
MS21043-3 NUT
2 PL

D3953-5
GAS SPRING STUD
REF

D3953-11
GAS SPRING SPACER

D3953-9
GAS SPRING WASHER

AN310-4 CASTELLATED NUT
MS24665-212 COTTER PIN
NAS1149C0432R WASHER

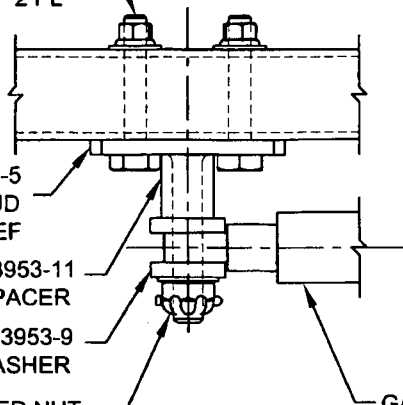

VIEW F-F

AN3C16A BOLT
NAS1149C0332R WASHER
MS21043-3 NUT
2 PL


D3953-13
GAS SPRING SPACER

D3953-1
GAS SPRING BRACKET
REF

D3953-7
GAS SPRING SPACER

D3953-9
GAS SPRING WASHER

D3953-3 GAS SPRING STUD
AN310-4 CASTELLATED NUT
MS24665-212 COTTER PIN
NAS1149C0432R WASHER

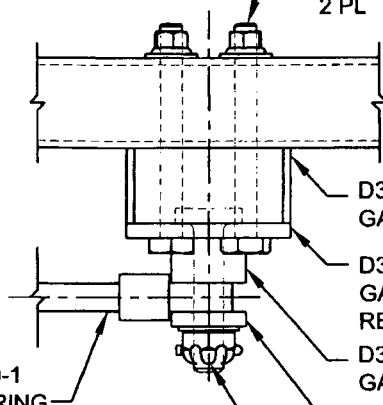


VIEW E-E

D3953-5
GAS SPRING STUD
REF

TRIM MESH LOCALLY
AS REQUIRED

TRANSFER MARK AND
DRILL Ø0.194 THRU
2 PL

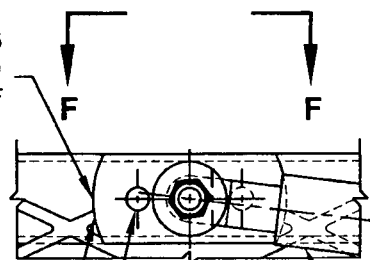


DETAIL B

TRIM MESH LOCALLY
AS REQUIRED

TRANSFER MARK AND
DRILL Ø0.194 THRU

D3953-1
GAS SPRING BRACKET
REF

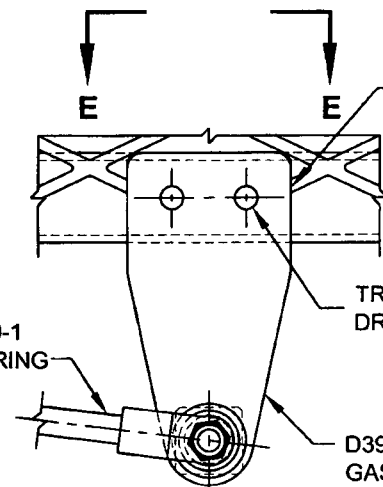

DETAIL A

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: *[Signature]*
D. SHEPHERD (DE # 02)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

DESIGN	AJS
DRAWN	AJS
CHECKED	<i>[Signature]</i>
MFG. APPR.	N/A
APPROVED	<i>[Signature]</i>
DE APPR.	<i>[Signature]</i>
DATE	09.11.11

DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA

DRAWING NO. REV. C
DSI 9473 SHEET 7 OF 8

TITLE SCALE
AUTOMATIC LID OPENER INSTL NTS

COPYRIGHT © 2009 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

AN3C15A BOLT
NAS1149C0332R WASHER
MS21043-3 NUT
2 PL

D3953-17
GAS SPRING SPACER
D3953-15
GAS SPRING BRACKET
REF
D3953-7
GAS SPRING SPACER
D3953-9
GAS SPRING WASHER

D3953-3 GAS SPRING STUD
AN310-4 CASTELLATED NUT
MS24665-212 COTTER PIN
NAS1149C0432R WASHER

VIEW G-G


AN3C11A BOLT
NAS1149C0332R WASHER
MS21043-3 NUT
2 PL

D3969-1
GAS SPRING
REF

D3953-5
GAS SPRING STUD
REF
D3953-11
GAS SPRING SPACER
D3953-9
GAS SPRING WASHER

AN310-4 CASTELLATED NUT
MS24665-212 COTTER PIN
NAS1149C0432R WASHER


VIEW H-H



D3953-15
GAS SPRING BRACKET
REF
TRANSFER MARK AND
DRILL Ø0.194 THRU

TRIM MESH LOCALLY
AS REQUIRED

DETAIL C

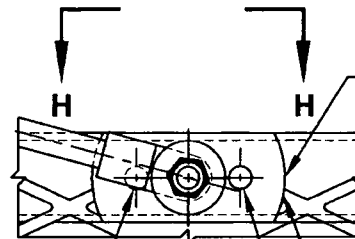

D3953-5
GAS SPRING STUD
REF

TRIM MESH LOCALLY
AS REQUIRED

TRANSFER MARK AND
DRILL Ø0.194 THRU

D3969-1
GAS SPRING
REF

DETAIL D

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: *[Signature]*
D. SHEPHERD (DE # 02)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

DESIGN	AJS
DRAWN	AJS
CHECKED	<i>[Signature]</i>
MFG. APPR.	N/A
APPROVED	<i>[Signature]</i>
DE APPR.	<i>[Signature]</i>
DATE	09.11.11

DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA

DRAWING NO. REV. C
DSI 9473 SHEET 8 OF 8

TITLE SCALE
AUTOMATIC LID OPENER INSTL NTS

COPYRIGHT © 2009 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD